

Vehicle

BMW 525D A, 160kW

WBAXB31000DW50042



Development code	F11
Color	sophisto-grau Brillanteffekt metallic
Actual integration level	F010-16-07-504
Start of warranty	November 24, 2011

▼ Technical Campaigns

There are no campaigns available.

▼ Special information

There are no campaigns available.

▼ Live Diagnosis

 There are no service solutions for Live Diagnosis.

▼ Service contracts

No BSI contracts available

You can find additional service contract information and selection options in the DCSNet warranty vehicle enquiry.

▼ Information on faults, workshop/Service Consultation

No information on faults is available.

▼ Navigation map

Installed map	Enabling code (subscription)	Latest navigation map included in subscription	Latest navigation map subject to charge
Road Map Europe West PREMIUM (USB) 2020-2 (as of: Dec 11, 2023)	Release code valid for navigation maps with release date up to Dec 31, 2025 (SWID: 0028008F).	Road Map Europe East PREMIUM (USB) 2025-2	-

▼ Vehicle details

Vehicle type	Passenger car
--------------	---------------

Brand	BMW
Model	525D A
Body	TOUR
Vehicle identification number (last 7 characters)	DW50042
Vehicle identification number (17 characters)	WBAXB31000DW50042
Development code	F11
Steering	LL
Engine	N47T
Engine number	77137992
Exhaust re-treatment	EURO5, F, PI/CI, M, N1 I
Transmission	AUT
Transmission number	4519576WVN
Head unit serial number	0007668048
Drive	HECK
Integration level	F010-11-09-505
Production date	Nov 8, 2011
Production works	Dingolfing
Delivery date	Nov 9, 2011
Delivering Retailers	ahg Autohandelsgesellschaft, Horb/Neckar, DE
National-market version	EUR
Paint code	B90
Upholstery code	LCCX
Model code	XB41
Base type	XB31
Lead type	XB41

▾ Optional equipment

Optional equipment fitted at the factory:

01CA Selection of COP relevant vehicles
 01CB CO2 package
 01CC Auto start/stop function
 01CD Brake Energy Regeneration
 0230 Extra package, EU-specific
 0255 Sports leather steering wheel
 0258 Tire with run-flat functionality
 02K2 BMW LA wheel, V Spoke 328
 02TB Sport automatic transmission
 02VB Tire pressure display
 0316 automatic trunk lid mechanism

Retrofitted optional equipment:

This vehicle has no retrofits.

0320 Deleted, model lettering
 03AC Trailer coupling
 03AG Reversing camera
 03AT Roof rail, aluminum, satin finish
 03MB Indiv. Ext. Line, burnished aluminium
 0402 Electric panoramic roof
 0418 Luggage compartment package
 0423 Floor mats, velours
 0428 Warning triangle and first aid kit
 0430 Interior/outside mirror with auto dip
 0431 Interior mirror with automatic-dip
 0456 Comfort seat with memory
 0488 Lumbar support, driver and passenger
 0494 Seat heating driver/passenger
 04AT Interior trim finishers black high-gloss
 04U2 Driving dynamics control incl. ECO PRO
 04UR Ambient interior lighting
 0502 Headlight cleaning system
 0508 Park Distance Control (PDC)
 0522 Xenon Light
 0534 Automatic air conditioning
 0548 Kilometer-calibrated speedometer
 0575 Additional 12V socket
 05DL Surround View
 0609 Navigation system Professional
 0610 Head-up display
 0612 BMW Assist
 0614 Internet, preparations
 0615 Expanded BMW Online Information
 0616 BMW Online
 0620 Voice control
 0633 Preparation, mobile phone, Business
 0676 HiFi speaker system
 0698 Area-Code 2 for DVD
 06AA BMW TeleServices
 06AB Control for Teleservices
 06FL USB/Audio interface
 06VC Control for Combox
 06WA Instrument cluster, expanded equipment
 0735 Basic Package
 07SP Nav Professional/cellph. prep. Bluetooth
 0801 German version
 0851 Language version German
 0879 On-board vehicle literature German
 08KA Oil service interval, 24 mos./30,000 km
 08TF Active pedestrian protection
 08TH Road sign detection
 08TN Daytime run.lights adjus.via light menu
 08V1 Label
 09BD Business Package
 A105 105 AH AGM battery

▾ Vehicle histories

	Date	Type	Vehicle mileage	Dealer	Overview
—	02/17/2025	Key	315597 km	21805	Key 0
	</				

								
13000	13000	13000	13000	29000			7000	43000
08/2025	08/2025	08/2025	08/2025		08/2025	08/2025		08/2027

—	12/11/2023	Repair	264320 km	21804 B&K GmbH , Uelzen	Job Job Job Job Job
---	------------	--------	-----------	-------------------------	---------------------------------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Ersatzfahrzeug Flat rate unit I 99 99 999	Local	1 FRU
Serienstandsverbesserung: 10011620600 du Flat rate unit I 99 99 999	Local	1 FRU
rchführen: E84 F0x F1x F2x F3x N47T AGR- Flat rate unit I 99 99 999	Local	1 FRU
Kühler (Hochtemperatur) ersetzen Flat rate unit I 99 99 999	Local	1 FRU
Replace exhaust-gas recirculation cooler, including exhaust-gas recirculation valve Flat rate unit I 00 73 003		22 FRU
Performing additional work for pressure sensor functional check Flat rate unit I 00 73 513		3 FRU
Performing additional work for pressure sensor functional check Flat rate unit I 00 73 513		3 FRU
Additional work: clean EGR pipe Flat rate unit I 00 73 515		6 FRU
!!! unknown BMW-Id FT991004 Frostschutz !!! Part I FT991004	Local	4
Exhaust gas cooler high temperature Part I 11 71 7 822 350		1
AGR small parts set Part I 11 71 8 490 640		1
Vacuum hose Part I 11 65 8 595 650		1
Pipe union Part I 11 71 7 799 853		2
Holder Part I 61 13 1 369 832		1
O-ring Part I 11 61 8 512 681		1

Acoustic cover front
Part I 11 14 8 490 568

1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Beratung am Fzg. mit Kunde
Flat rate unit I 00 90 105

Local

1 FRU

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Interne Qualitätssicherung
Flat rate unit I 00 91 113

Local

4 FRU

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Kostenlose maschinelle Oberwäsche
Flat rate unit I 00 91 200

Local

1 FRU

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Ersatzwagen Intern
Flat rate unit I 00 91 602

Local

1 FRU

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Serienstandsverbesserung: 10011350700 du rchführen: E84 Fx Gx Bx7 Local
Nx7 Kundenbenac
Flat rate unit I ISPWERK

1 FRU

Administrative effort
Flat rate unit I 00 74 758

1 FRU

— 08/02/2022 Key

210427 km

07331

Key 0

								
3500	3500	3500	3500	5000			41000	34000
06/2023	06/2023	06/2023	06/2023		06/2023	06/2023		06/2025

— 01/07/2022 Key 189760 km Key 0

								
24000	24000	24000	24000	15000			60000	60000
06/2023	518	518	518		06/2023	518		1238

— 01/07/2022 Repair 189760 km 33995 ahg Job
Autohandelsgesellschaft mbH , Achern Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Sommerräder montieren (Räder wechseln ohne wuchten)	Local	4 FRU
Flat rate unit I 98 36 001		

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Performing vehicle test	3 FRU
Flat rate unit I 00 00 556	
Work time without specification/engine	6 FRU
Flat rate unit I 11 99 000	
Replacing both engine mounts	21 FRU
Flat rate unit I 22 11 021	
Supporting the voltage of the vehicle electrical system/recharging the vehicle electrical system battery	1 FRU
Flat rate unit I 61 21 528	
Hex bolt with washer	1
Part I 07 11 9 905 893	
Hex bolt with washer	1
Part I 07 11 9 905 893	
Hex bolt with washer	10
Part I 07 11 9 907 017	
Star-socket screw	1
Part I 07 11 9 908 507	
Engine mount, right	1
Part I 22 11 7 935 142	
Engine mount	1

—	08/18/2020	Key	175961 km	30778	Key 0
---	------------	-----	-----------	-------	-------

							
18000	18000	18000	18000	26000	0	70000	18000
03/2021	225	225	225		03/2021		03/2021

—	08/18/2020	Repair	175962 km	30778	Job
				Reisacher	Job
				Augsburg	Job
				GmbH ,	Job
				Augsburg	

— Job

Description: Standardcheck by Autohaus Augsburg

Is interpreted as a repeat visit: No

Customer's own words:

!!! unknown BMW-Id 0099001 Standardcheck by Autohaus Augsburg - Local kostenlos- !!! Flat rate unit I 00 99 001	2 FRU
---	-------

Outside car wash Flat rate unit I 00 11 319	0 FRU
--	-------

Service consultation at the vehicle with customer without service ticket Flat rate unit I 00 52 053	0 FRU
--	-------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Bereitstellen zur Hauptuntersuchung Flat rate unit I -	Local	1 FRU
---	-------	-------

Abgasmessung mit OBD Flat rate unit I -	Local	5 FRU
--	-------	-------

— Job

Description: Technische Aktion AGR Kühler prüfen ggf. ersetzen

Is interpreted as a repeat visit: No

Customer's own words:

Checking the index exhaust-gas recirculation cooler Flat rate unit I 00 67 707	3 FRU
---	-------

— Job

Description: Navi Update aufspielen

Is interpreted as a repeat visit: No

Customer's own words:

!!! unknown BMW-Id 6599010 Freischaltung von Navigationskarten mit Local
Freischaltcode !!!
Flat rate unit I 65 99 010

3 FRU

Enable code CIC map Europe Premium Upd.
Part I 65 90 2 406 560

1

— 03/13/2019 Key 163521 km Key 0



— 03/13/2019 Repair 163521 km 30778 Job
Reisacher Job
Augsburg Job
GmbH ,
Augsburg

— Job

Description: Standardcheck by Autohaus Augsburg

Is interpreted as a repeat visit: No

Customer's own words:

!!! unknown BMW-Id 0099001 Standardcheck by Autohaus Augsburg - Local
kostenlos- !!!
Flat rate unit I 00 99 001

2 FRU

Outside car wash
Flat rate unit I 00 11 319

0 FRU

Service consultation at the vehicle
Flat rate unit I 00 52 050

0 FRU

USB charger for type A
Part I 65 41 2 458 284

1

— Job

Description: UVV/12-Punkte Check / Fahrzeugcheck vor Ablauf GA

Is interpreted as a repeat visit: No

Customer's own words:

Removing and installing or replacing both gas pressure props for engine
hood
Flat rate unit I 51 23 766

1 FRU

— Job

Description: fällige Wartung durchführen

Is interpreted as a repeat visit: No

Customer's own words:

!!! unknown BMW-Id 0099272 12-Punkte-Check BMW Financial
Service !!!
Flat rate unit I 00 99 272

Local

8 FRU

Engine oil service

3 FRU

Flat rate unit I 00 00 610

Standard scope of service 2 FRU

Flat rate unit I 00 00 105

Service - microfilter 3 FRU

Flat rate unit I 00 00 616

Brake fluid service 4 FRU

Flat rate unit I 00 00 618

Rear brakes service 8 FRU

Flat rate unit I 00 00 614

Removing and installing/renewing both brake discs 2 FRU

Flat rate unit I 34 21 932

!!! unknown BMW-Id 99992158851 Bremsklotzpaste 3g !!! Local 2

Part I 99 99 2 158 851

Set oil-filter element 1

Part I 11 42 8 507 683

BMW Engine Oil LL04 0W30 5.2

Part I 83 21 2 405 950

Set, microfilter/activ. charcoal filter 1

Part I 64 11 9 272 642

Brake fluid DOT4 LV, low viscosity 1

Part I 83 13 2 184 843

Repair kit, brake pads asbestos-free 1

Part I 34 21 6 862 202

Brake pad wear sensor, rear 1

Part I 34 35 6 791 963

Brake cleaner, acetone-free 1

Part I 83 19 2 413 695

Windshield Washer Antifreeze 2

Part I 83 12 2 409 031

Gas spring front flap, active 2

Part I 51 23 7 309 117

Brake disc, lightweight, ventilated 2

Part I 34 21 6 775 287

Inner hex bolt 2

Part I 34 21 1 161 806









Torx screw with washer 4

Part I 34 10 6 864 424

Fuse 1

Part I 61 14 6 953 470

— 04/23/2018 Key 153201 km 30778 Key 0



—	04/23/2018	Repair	153204 km	30778 Reisacher Augsburg GmbH, Augsburg	Job Job Job
---	------------	--------	-----------	---	-------------------

— Job

Description: Standardcheck by Autohaus Augsburg

Is interpreted as a repeat visit: No

Customer's own words:

!!! unknown BMW-Id 0099001 Standardcheck by Autohaus Augsburg - Local kostenlos- !!! Flat rate unit I 00 99 001	2 FRU
---	-------

Outside car wash Flat rate unit I 00 11 319	0 FRU
--	-------

Service consultation at the vehicle with customer without service ticket Flat rate unit I 00 52 053	0 FRU
--	-------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Work time without specification/engine Flat rate unit I 11 99 000	16 FRU
--	--------

Removing and installing/sealing or replacing the oil return line for the low- pressure stage turbocharger Flat rate unit I 11 42 645	6 FRU
--	-------

Attaching and detaching/sealing or replacing the oil return line for the high pressure exhaust turbocharger Flat rate unit I 11 42 640	21 FRU
--	--------

Gasket Asbestos Free Part I 11 42 2 246 091	1
--	---

Hose Part I 11 42 2 249 206	1
--------------------------------	---

Hose clamp Part I 07 12 9 952 109	2
--------------------------------------	---

Hose Part I 11 42 7 807 796	1
--------------------------------	---

Hose clamp Part I 64 21 8 367 179	2
--------------------------------------	---

O-ring Part I 12 72 7 694 011	1
----------------------------------	---

ISA screw Part I 07 12 9 905 536	1
-------------------------------------	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Performing vehicle test Flat rate unit I 00 00 556	3 FRU
Work time without specification/integrated suspension systems Flat rate unit I 37 99 000	1 FRU
Removing and installing or replacing left or right air spring Flat rate unit I 37 12 525	9 FRU
Pneumatic spring, rear Part I 37 10 6 784 379	1

—	11/06/2017	Key	146903 km	30778	Key 0
---	------------	-----	-----------	-------	-------

 20000 11/2018	 0	 20000 388	 0	 70000	 0 11/2018	 5000	 50000 11/2020
---	--	---	--	--	---	---	--

—	11/06/2017	Repair	146913 km	02341 Drexl + Ziegler GmbH & Co. KG , Neusäß
---	------------	--------	-----------	---

—	11/06/2017	Repair	146913 km	30778	Job
				Reisacher	Job
				Augsburg	Job
				GmbH ,	Job
				Augsburg	Job

— Job

Description: Standardcheck by Autohaus Augsburg

Is interpreted as a repeat visit: No

Customer's own words:

!!! unknown BMW-Id 0099001 Standardcheck by Autohaus Augsburg - Local kostenlos- !!! Flat rate unit I 00 99 001	2 FRU
Outside car wash Flat rate unit I 00 11 319	0 FRU

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Work time without specification/engine Flat rate unit I 11 99 000	10 FRU
Replace the cylinder head cover Flat rate unit I 11 12 001	37 FRU
O-ring Part I 11 12 8 510 539	1

Cylinder head cover Part I 11 12 8 589 941	1
---	---

Gasket ring Part I 13 53 2 247 156	4
---------------------------------------	---

O-ring Part I 13 62 7 796 699	1
----------------------------------	---

— Job

Description: unten läuft Wasserraus

Is interpreted as a repeat visit: No

Customer's own words:

Removing and installing/replacing the sound insulation at the rear left or right door Flat rate unit I 51 48 070	8 FRU
---	-------

Removing and installing/replacing the sound insulation at the rear left or right door Flat rate unit I 51 48 570	7 FRU
---	-------

Sound insulating door rear left Part I 51 48 7 366 707	1
---	---

Sound insulating door rear right Part I 51 48 7 366 708	1
--	---

Butyl cord Terostat 2460 Part I 83 19 0 429 522	6
--	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Carrying out vehicle test Flat rate unit I 00 00 006	4 FRU
---	-------

Work time without specification/integrated suspension systems Flat rate unit I 37 99 000	10 FRU
---	--------

Removing and installing/replacing air spring, left or right Flat rate unit I 37 12 155	10 FRU
---	--------

Pneumatic spring, rear Part I 37 10 6 784 379	1
--	---

Air intake tube left Part I 37 20 6 793 277	1
--	---

Screw connection Part I 37 22 1 092 403	4
--	---

— Job

Description: UVV/12-Punkte Check / Fahrzeugcheck vor Ablauf GA

Is interpreted as a repeat visit: No

Customer's own words:

!!! unknown BMW-Id 0099272 12-Punkte-Check BMW Financial
 Service Rechnung an KD-Nr. 024453 !!!
 Flat rate unit I 00 99 272

Local

8 FRU

—	10/17/2017	Key	146376 km	30778	Key 0		
							
21000	0	21000	0	70000	0	5000	50000
11/2018		409			11/2018		11/2020

—	08/21/2017	Key	145294 km	02341	Key 0		
							
22000	0	22000	0	70000	0	5000	50000
11/2018		466			11/2018		11/2020

—	07/10/2017	Key	143129 km	02341	Key 0		
							
23000	0	23000	0	70000	0	6000	50000
11/2018		508			11/2018		11/2020

—	07/10/2017	Repair	145379 km	02341 Drexl + Ziegler GmbH & Co. KG , Neusäß	Job Job
---	------------	--------	-----------	---	------------

— Job

Description: Prüfen ggf. inst.

Is interpreted as a repeat visit: No

Customer's own words:

Removing and installing/sealing cylinder head cover	36 FRU
Flat rate unit I 11 12 000	

Removing and installing or replacing EGR cooler	16 FRU
Flat rate unit I 11 71 600	

Original BMW Twin Power Turbo Shell SAE 5W-30 Longlife-04	Local	0.75
Part I 5W30		

!!! unknown BMW-Id 99991000025 Kühlmittel !!!	Local	4
Part I 99 99 1 000 025		

Gasket set, cylinder head cover	1
Part I 11 12 8 511 814	

Gasket ring	4
Part I 13 53 2 247 156	

Exhaust gas cooler high temperature	1
Part I 11 71 7 823 210	

Pipe union	1
Part I 11 71 7 799 853	

Gasket Steel
Part I 11 61 8 508 626

1

Vacuum hose black
Part I 11 74 7 797 129

1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Checking software version and replacing IHKR heater controls
Flat rate unit I 00 52 060

1 FRU

Work time without specification/engine
Flat rate unit I 11 99 000

0 FRU


Gasket set, cylinder head cover
Part I 11 12 8 511 814

2

Gasket set, cylinder head cover
Part I 11 12 8 511 814

-2

— 02/20/2017 Key 139396 km 02341 Key 0

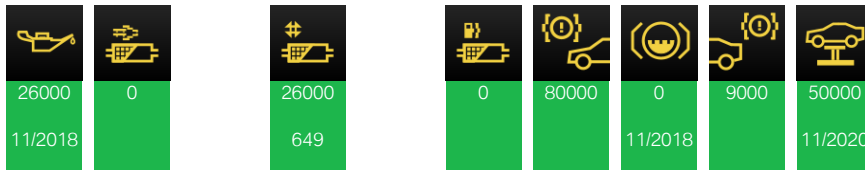

— 02/20/2017 Repair 139396 km 02341 Drexl + Ziegler GmbH & Co. KG , Neusäß Job

— Job

Description: Prüfen ggf. inst.

Is interpreted as a repeat visit: No

Customer's own words:

Removing and installing/replacing clean air pipe
Flat rate unit I 13 71 035

5 FRU


Work time without specification/engine
Flat rate unit I 11 99 000

3 FRU

Pipe
Part I 13 71 7 810 772

1

— 02/02/2017 Key 138981 km 02341 Key 0

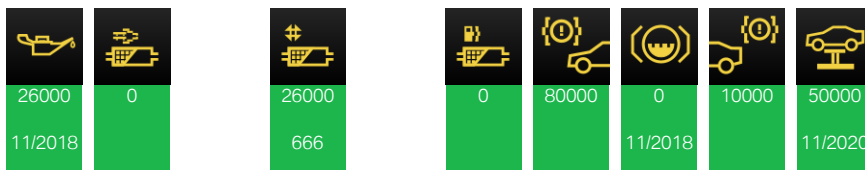

—	02/02/2017	Repair	138981 km	02341 Drexl + Ziegler GmbH & Co. KG , Neusäß	Job Job
---	------------	--------	-----------	---	------------

— Job

Description: prüfen ggf. instand setzen

Is interpreted as a repeat visit: No

Customer's own words:

Carrying out vehicle test Flat rate unit I 00 00 006	4 FRU
---	-------

Carrying out vehicle diagnosis, ABL Flat rate unit I 61 00 006	3 FRU
---	-------

Replacing seat cover for driver's seat Flat rate unit I 52 17 902	26 FRU
--	--------

Cover for comfort seat, leather Part I 52 10 7 232 849	1
---	---

Fillister head screw Part I 07 14 9 156 953	4
--	---

Clamp Part I 52 10 1 945 543	30
---------------------------------	----

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

kostenlose Wagenwäsche + Fußraum aussaugen Flat rate unit I AW00 00 1	Local	3 FRU
--	-------	-------

!!! unknown BMW-Id 0020000 Fahrzeug-Endkontrolle !!! Flat rate unit I 00 20 000	Local	1 FRU
--	-------	-------

Checking software version and replacing IHKR heater controls Flat rate unit I 00 52 060	1 FRU
--	-------

—	12/27/2016	Repair	137287 km	33995 ahg Autohandelsgesellschaft mbH , Achern	Job
---	------------	--------	-----------	--	-----

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Replacing right decor strip on instrument panel Flat rate unit I 51 45 882	4 FRU
---	-------

Trim instr.panel glossy black passenger Part I 51 45 9 166 649	1
---	---

—	12/20/2016	Repair	137286 km	33995 ahg Autohandelsgesellschaft mbH , Achern	Job Job Job Job
---	------------	--------	-----------	--	--------------------------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Paket 6 Auslieferung m.Pre.S Auslieferungsscheck Flat rate unit I 00 00 077	Local	6 FRU
Feinstaubplakette grün Part I FT1803	Local	1
SCHEIBENKLAR Part I FT99 99 9 407 8	Local	2
Battery Part I 61 31 9 217 643		1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Standard scope of service Flat rate unit I 00 00 105		2 FRU
Service - front brakes Flat rate unit I 00 00 612		7 FRU
Removing and installing/replacing both front brake discs Flat rate unit I 34 11 613		3 FRU
Hex bolt Part I 34 11 6 772 117		4
Brake disc, lightweight, ventilated Part I 34 11 6 775 277		2
Repair kit, brake pads asbestos-free Part I 34 11 6 850 885		1
Inner hex bolt Part I 34 21 1 161 806		2
Clip retainer Part I 34 35 6 787 325		1
Brake pad wear sensor, front left Part I 34 35 6 791 958		1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

4 neue Winterreifen montieren auf LM-Räder von GW Fgst.-Nr. DP47457 Flat rate unit I 36 99 009	Local	16 FRU
RDC nachrüsten INTERN Flat rate unit I 36 99 103	Local	4 FRU
Work time without specification/wheels Flat rate unit I 36 99 000		0 FRU
Dunlop SP WintSpor3D RFT*225/55 R17 97H Part I FT40 38 5 262 7	Local	4
Screw-in valve RDC Part I 36 14 6 792 829		4

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Smart Repair SRP Stoßfänger vore.+li,4 Felgen, Kotflü+Tü. v.r Flat rate unit I 99 99 999	Local	1 FRU
VFW / POOL tanken Flat rate unit I 98 00 010	Local	3 FRU

— 11/28/2016 Key 137286 km 33995 Key 0

							
27000	0	27000	0	6000	0	11000	50000
11/2018		741			11/2018		11/2020

— 11/09/2016 Key 136998 km 33995 Key 0

							
-380	-380	-380	-380	6000	0	11000	-380
08/2017	295	295	295		01/2017		08/2017

— 11/09/2016 Service 136998 km 33995 AHG Automatic
Autohandelsgesellschaft
mbH , Achern

							
-380	-380	-380	-380	6000	0	11000	-380
08/2017	08/2017	08/2017	08/2017		01/2017		08/2017
✓	✓	✓	✓		✓		✓

— 11/09/2016 Repair 136998 km 33995 ahg Job
Autohandelsgesellschaft Job
mbH , Achern Job
Job
Job
Job
Job
Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Standard scope of service	2 FRU
Flat rate unit I 00 00 105	

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service - microfilter	3 FRU
Flat rate unit I 00 00 616	

Set, microfilter/activ. charcoal filter	1
Part I 64 11 9 272 642	

Pollen filter housing cleaner	1
Part I 83 19 2 180 509	

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Vehicle check service	7 FRU
Flat rate unit I 00 00 624	

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service - air filter insert	1 FRU
Flat rate unit I 00 00 602	

Air filter element	1
Part I 13 71 7 800 151	

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fuel filter service	5 FRU
Flat rate unit I 00 00 604	

Schlauchschelle L12-15	Local	1
Part I FT07129952104		

Fuel filter cartridge
Part I 13 32 7 811 227

1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Brake fluid service	4 FRU
Flat rate unit I 00 00 618	

Bremsflüssigkeit DOT 4	Local	1
Part I FT99889400156		

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Engine oil service	3 FRU
Flat rate unit I 00 00 610	

Montagereiniger	Local	0.2
Part I 47 11 1 905 105		

Motorenöl Longlife 04	Local	5.2
Part I FT99990000547		

Screw plug	1	
Part I 11 13 7 535 106		

Set oil-filter element	1	
Part I 11 42 8 507 683		

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fußraum saugen und Wagenoberwäsche	Local	0 FRU
Flat rate unit I 99 99 319		

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

12-Punkte Fahrzeug-Check (Gutschein Gutschrift)	Local	12 FRU
Flat rate unit I 98 99 600		

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

—	11/09/2016	Repair	136998 km	33995 ahg Autohandelsgesellschaft mbH , Achern	Job
---	------------	--------	-----------	--	-----

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

12-Punkte Fahrzeug-Check Flat rate unit I 98 99 600	Local	12 FRU
--	-------	--------

—	08/16/2016	Key	131138 km	33995	Key 0
---	------------	-----	-----------	-------	-------

								
7000	7000	7000	7000	12000	0	17000	7000	7000
08/2017	380	380	380		01/2017		08/2017	

—	08/16/2016	Repair	131138 km	33995 ahg Autohandelsgesellschaft mbH , Achern	Job
---	------------	--------	-----------	--	-----

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Performing vehicle test Flat rate unit I 00 00 556	3 FRU
---	-------

Carrying out vehicle diagnosis, ABL Flat rate unit I 61 00 006	4 FRU
---	-------

Program/encode control unit(s), includes deleting the fault memory Flat rate unit I 61 00 730	4 FRU
--	-------

Replacing complete trailer tow hitch Flat rate unit I 71 60 055	13 FRU
--	--------

Steuergerät AHK 20% Anteil Part I 71 60 6 856 980	Local	1
--	-------	---

Satz Anhängerkupplun elektr.schw. 20% Ant Part I 71 60 6 874 904	Local	1
---	-------	---

—	04/29/2016	Key	125282 km	33995	Key 0
---	------------	-----	-----------	-------	-------

								
14000	14000	14000	14000	41000	0	5000	14000	14000
08/2017	489	489	489		01/2017		08/2017	

—	04/29/2016	Repair	125282 km	33995 ahg Autohandelsgesellschaft	Job
---	------------	--------	-----------	--------------------------------------	-----

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

12-Punkte Fahrzeug-Check
Flat rate unit I 98 99 600

Local






12 FRU

— 08/13/2015 Key

110213 km

33994

Key 0



— 08/13/2015 Repair

110213 km

33995 ahg
Autohandelsgesellschaft
mbH , Achern

Job
Job
Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Standard scope of service
Flat rate unit I 00 00 105

2 FRU

Engine oil service
Flat rate unit I 00 00 610

3 FRU

Montagereiniger
Part I 47 11 1 905 105

Local

1

Motorenöl Longlife-04
Part I FT99 88 7 766 8

Local

5.2

Set oil-filter element
Part I 11 42 8 507 683

1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service - microfilter
Flat rate unit I 00 00 616

3 FRU

Set, microfilter/activ. charcoal filter
Part I 64 11 9 272 642

1

Pollen filter housing cleaner
Part I 83 19 2 180 509

1

— Job

Description:**Is interpreted as a repeat visit:** No**Customer's own words:**

Fußraum saugen und Wagenoberwäsche	Local	2 FRU
Flat rate unit I 99 99 319		

SCHEIBENKLAR	Local	1
Part I FT99 99 9 407 8		

—	08/13/2015	Repair	110213 km	33995 ahg Autohandelsgesellschaft mbH , Achern	Job Job
---	------------	--------	-----------	--	------------

— Job

Description:**Is interpreted as a repeat visit:** No**Customer's own words:**

Removing and installing bonnet	4 FRU
Flat rate unit I 41 61 510	

Work time without specification/body equipment	2 FRU
Flat rate unit I 51 99 000	

Work time without specification/body	6 FRU
Flat rate unit I 41 99 000	

Work time without specification/body	3 FRU
Flat rate unit I 41 99 000	

Work time without specification/body	7 FRU
Flat rate unit I 41 99 000	

Work time without specification/vehicle underbody preservation	2 FRU
Flat rate unit I 97 99 000	

KORROSIONSSCHUTZ	Local	1
Part I FT9034001		

— Job

Description:**Is interpreted as a repeat visit:** No**Customer's own words:**

Frontklappe sanft instand - setzen	Local	1 FRU
Flat rate unit I 99 99 999		

—	04/13/2015	Repair	102930 km	33995 ahg Autohandelsgesellschaft mbH , Achern	Job
---	------------	--------	-----------	--	-----

— Job

Description:**Is interpreted as a repeat visit:** No**Customer's own words:**

12-Punkte Fahrzeug-Check
Flat rate unit I 98 99 600

Local

-12 FRU

— 04/13/2015 Repair 102930 km 33995 ahg
Autohandelsgesellschaft
mbH , Achern Job

— Job

Description:

Is interpreted as a repeat visit: No









Customer's own words:

12-Punkte Fahrzeug-Check
Flat rate unit I 98 99 600

Local

12 FRU

— 03/26/2015 Key 102930 km 33994 Key 0



— 03/26/2015 Repair 102930 km 33995 ahg
Autohandelsgesellschaft
mbH , Achern Job Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Reifen montieren und wuchten. (Reifen ab 18 / RFT/Offroad inkl.
Wuchtgew.) angeliefert
Flat rate unit I 36 99 109

Local

12 FRU

Reifenventil
Part I 47 36 7 343 673

Local

2

Wuchtgewichte
Part I 47 36 9 824 843

Local

2

ALTREIFEN-ENTSORGUNG
Part I FT90 36 0 000 9

Local

2

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fußraum saugen und Wagenoberwäsche
Flat rate unit I 99 99 319

Local

2 FRU

— 03/26/2015 Repair 102930 km 33995 ahg
Autohandelsgesellschaft

— Job


Description:

Is interpreted as a repeat visit: No

Customer's own words:

12-Punkte Fahrzeug-Check Flat rate unit I 98 99 600	Local	12 FRU
--	-------	--------

—	01/16/2015	Key	99164 km	33994	Key 0
---	------------	-----	----------	-------	-------

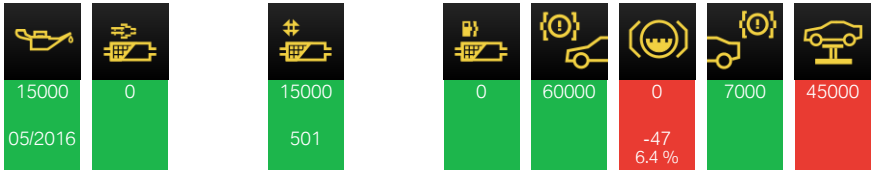

—	01/16/2015	Repair	99164 km	33995 ahg Autohandelsgesellschaft mbH , Achern	Job
---	------------	--------	----------	--	-----

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fußraum saugen und Wagenoberwäsche Flat rate unit I 99 99 319	Local	2 FRU
--	-------	-------

—	01/16/2015	Repair	99164 km	33995 ahg Autohandelsgesellschaft mbH , Achern	Job
---	------------	--------	----------	--	-----

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:


Standard scope of service Flat rate unit I 00 00 105		2 FRU
---	--	-------

Brake fluid service Flat rate unit I 00 00 618		4 FRU
---	--	-------


Bremsenreiniger Part I 47 34 8 829 561	Local	0.5
---	-------	-----

Bremsflüssigkeit DOT 4 Part I FT99 88 9 400 1	Local	1
--	-------	---


—	05/26/2014	Key	85182 km	33994	Key 0
---	------------	-----	----------	-------	-------




2800
08/2015




2800
462




2800
462




2800
462




11000



0
11/2014



11000



2800
08/2015

—

05/26/2014 Repair

85182 km

33995 ahg
Autohandelsgesellschaft
mbH , Achern

Job
Job
Job
Job
Job
Job
Job
Job
Job
Job
Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Standard scope of service Flat rate unit I 00 00 105	2 FRU
---	-------

Engine oil service Flat rate unit I 00 00 610	3 FRU
--	-------

Motorenöl Part I FT99 99 0 000 5	Local	5.2
-------------------------------------	-------	-----

Set oil-filter element Part I 11 42 8 507 683	1
--	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service - microfilter Flat rate unit I 00 00 616	3 FRU
---	-------

Set, microfilter/activ. charcoal filter Part I 64 11 9 272 642	1
---	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service - air filter insert Flat rate unit I 00 00 602	1 FRU
---	-------

Air filter element Part I 13 71 7 800 151	1
--	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fuel filter service Flat rate unit I 00 00 604	5 FRU
Hose clamp Part I 07 12 9 952 104	2
Fuel filter cartridge Part I 13 32 7 811 227	1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Vehicle check service Flat rate unit I 00 00 624	7 FRU
Recharging vehicle battery Flat rate unit I 61 21 509	1 FRU
SCHEIBENKLAR mit Frostschutz Part I FT99 99 9 407 8	Local 2

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Statutory emission test Flat rate unit I 00 00 440	6 FRU
(statutory) general inspection Flat rate unit I 00 12 159	0 FRU
Hauptuntersuchung § 29 Part I FT9894901	Local 1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service - front brakes Flat rate unit I 00 00 612	7 FRU
Work time without specification/brakes Flat rate unit I 34 99 000	4 FRU
Repair kit, brake pads asbestos-free Part I 34 11 6 850 885	1
Brake pad wear sensor, front left	1

— Job

Description:**Is interpreted as a repeat visit:** No**Customer's own words:**

Work time without specification/wheels	0 FRU
Flat rate unit I 36 99 000	

CTI SportContact 3 245/45R18 96Y CONTI	Local	2
Part I FT40 19 2 383 5		

— Job

Description:**Is interpreted as a repeat visit:** No**Customer's own words:**

Vent the cooling system and check for watertightness with the special tool	5 FRU
Flat rate unit I 17 00 039	

Work time without specification/radiator	5 FRU
Flat rate unit I 17 99 000	

KUEHLFLÜSSIGKEIT	Local	1.5
Part I FT99 88 7 721 7		

Coolant hose	1
Part I 17 12 7 809 820	

— Job

Description:**Is interpreted as a repeat visit:** No**Customer's own words:**

Removing and installing/replacing sill trim, front left or right	3 FRU
Flat rate unit I 51 47 065	

Front left entrance cover	1
Part I 51 47 7 203 601	

— Job

Description:**Is interpreted as a repeat visit:** No**Customer's own words:**

Work time without specification / vehicle electrical system	1 FRU
Flat rate unit I 61 99 000	

Battery	2
Part I 61 31 9 217 643	

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fzg Endfinisch durchführen Kennzeichen montieren CBS Einträge
prüfen u. löschen Local 7 FRU
Flat rate unit I 98 00 004

— 05/19/2014 Key 84661 km 33994 Key 0

							
3300	3300	3300	3300	12000	0	12000	3300
08/2015	469	469	469		11/2014		08/2015

— 05/19/2014 Repair 84661 km 33995 ahg Job
Autohandelsgesellschaft Job
mbH , Achern Job
Job
Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Performing vehicle test 3 FRU
Flat rate unit I 00 00 556

Replacing the exhaust-gas recirculation valve 5 FRU
Flat rate unit I 11 71 501

Carrying out vehicle diagnosis, ABL 4 FRU
Flat rate unit I 61 00 006

Resume vehicle test and clear fault memory 2 FRU
Flat rate unit I 61 00 980

Work time without specification / vehicle electrical system 4 FRU
Flat rate unit I 61 99 000

EGR-valve 1
Part I 11 71 7 810 871

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Carrying out vehicle test 4 FRU
Flat rate unit I 00 00 006

Work time without specification/engine 16 FRU
Flat rate unit I 11 99 000

Troubleshooting in the electrical/electronic system 4 FRU
Flat rate unit I 61 00 009

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Work time without specification/body equipment Flat rate unit I 51 99 000	5 FRU
Hex bolt with washer Part I 07 11 9 905 147	10
Hex bolt Part I 07 14 7 029 829	1
Crossbrace, rear right Part I 51 71 7 180 316	1
Crossbrace, front right Part I 51 71 7 180 318	1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Replacing front BMW badge Flat rate unit I 51 14 501	1 FRU
Badge Part I 51 14 7 057 794	1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fußraum saugen und Wagenoberwäsche Flat rate unit I 99 99 319	Local	2 FRU
--	-------	-------

—	12/02/2013	Repair	75675 km	26842 BMW Mobiler Service Einsatzleitzentrale , München	Job
---	------------	--------	----------	--	-----

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

—	11/27/2013	Repair	74911 km	27941 Vogel Autohäuser GmbH & Co. KG, Zwingenberg	Job Job Job
---	------------	--------	----------	---	-------------------

— Job

Description:**Is interpreted as a repeat visit:** No**Customer's own words:**

Fahrzeugtest durchführen Flat rate unit I 00 00 006	Local	4 FRU
Störungssuche BMW-Diagnose-System Flat rate unit I 12 00 009	Local	12 FRU
Steuergerät(e) programmieren/ codieren Flat rate unit I 61 00 730	Local	4 FRU
Fahrzeugtest fortführen und Quick löschen durchführen Flat rate unit I 61 00 980	Local	2 FRU
Reifen Pannen Anzeige initialisieren Flat rate unit I 36 11 500	Local	1 FRU
Schiebehebedach und Fensterheber initialisieren Flat rate unit I 61 00 830	Local	1 FRU

— Job**Description:****Is interpreted as a repeat visit:** No**Customer's own words:**

Fahrzeug Fußraum vorne aussaugen / Wagenwäsche Flat rate unit I 00 11 317	Local	1 FRU
--	-------	-------

— Job**Description:****Is interpreted as a repeat visit:** No**Customer's own words:**

Ihre Rechnung wurde von Ihrem Serviceberater Flat rate unit I 55 55 555	Local	1 FRU
--	-------	-------

—	11/27/2013	Repair	74911 km	27941 Vogel Autohäuser GmbH & Co. KG , Zwingenberg	Job
---	------------	--------	----------	--	-----

— Job**Description:****Is interpreted as a repeat visit:** No**Customer's own words:**

1 Tag Mietwagen Fa. AVIS Flat rate unit I 99 99 999	Local	1 FRU
WI-AN 4205 Flat rate unit I 99 99 999	Local	1 FRU

Fahrer: Stefan Thorsch
Flat rate unit I 99 99 999

Local

1 FRU

—	11/20/2013	Repair	74911 km	27941 Vogel Autohäuser GmbH & Co. KG , Zwingenberg	Job Job Job Job
---	------------	--------	----------	--	--------------------------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Vier Reifen mit Runflatausführung ersetzen
Flat rate unit I 36 12 577

Local

24 FRU

GEWICHT
Part I 99 99 0 000 025

Local

4

Dunlop SP Winter Sport 3D ROF
Part I 85 45 2 543 623

1

Dunlop SP Winter Sport 3D ROF
Part I 85 45 2 543 623

1

Dunlop SP Winter Sport 3D ROF
Part I 85 45 2 543 623

1

Dunlop SP Winter Sport 3D ROF
Part I 85 45 2 543 623

1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Paket B A S I S - Räderwechsel
Flat rate unit I BASISZ

Local

6 FRU

SR einlagern
Flat rate unit I 99 99 999

Local

1 FRU

SOMMERRÄDER - Lagerung
Part I 99 99 0 000 058

Local

1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fahrzeug Fußraum vorne aussaugen / Wagenwäsche
Flat rate unit I 00 11 317

Local

1 FRU

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Ihre Rechnung wurde von Ihrem Serviceberater
Flat rate unit I 55 55 555

Local

1 FRU

— 08/10/2013 Repair 56794 km 27941 Vogel Job
Autohäuser Job
GmbH & Co. Job
KG ,
Zwingenberg

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Standardumfang
Flat rate unit I 00 00 105

Local

2 FRU

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Bremse hinten
Flat rate unit I 00 00 614

Local

8 FRU

Repair kit, brake pads asbestos-free
Part I 34 21 6 862 202

1

Brake pad wear sensor, rear
Part I 34 35 6 791 963

1

Safety cleaner
Part I 83 19 0 444 555

1

Brake pad paste
Part I 83 19 2 158 851

1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Ihre Rechnung wurde von Ihrem Serviceleiter
Flat rate unit I 11 11 111

Local

1 FRU

— 08/10/2013 Repair 56794 km 27941 Vogel Job
Autohäuser Job
GmbH & Co. Job
KG ,
Zwingenberg

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Motoröl Flat rate unit I 00 00 610	Local	3 FRU
Set oil-filter element Part I 11 42 8 507 683		1
Motor oil SAE 5W-30 Longlife-04 Part I 83 21 0 398 509		5.2

— Job







Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Mikrofilter Flat rate unit I 00 00 616	Local	3 FRU
Set, microfilter/activ. charcoal filter Part I 64 11 9 272 642		1

— 04/29/2013 Key 56794 km 27941 Key 0



— 04/29/2013 Repair 56794 km 27941 Vogel
Autohäuser
GmbH & Co.
KG ,
Zwingenberg Job
Job
Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Paket B A S I S - Räderwechsel Flat rate unit I BASISZ	Local	6 FRU
WINTERRÄDER - Lagerung Part I 99 99 0 000 059	Local	1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fahrzeug Fußraum vorne aussaugen / Wagenwäsche Flat rate unit I 00 11 317	Local	1 FRU
--	-------	-------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Ihre Rechnung wurde von Ihrem Serviceberater
Flat rate unit I 44 44 444

Local

1 FRU

—

04/29/2013 Repair

56794 km

27941 Vogel
Autohäuser
GmbH & Co.
KG ,
Zwingenberg

Job
Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Wheel bolt black
Part I 36 13 6 781 151

20

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Ihre Rechnung wurde von Ihrem Serviceberater
Flat rate unit I 44 44 444

Local


1 FRU

—

01/04/2013 Key

44284 km

Key 0

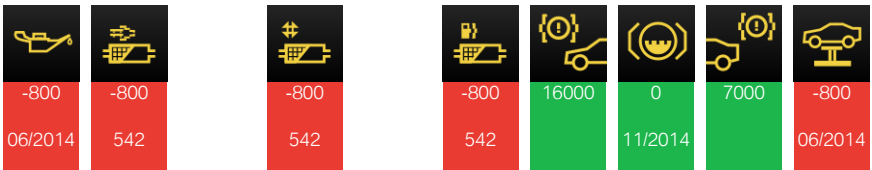

—

01/04/2013 Repair

44284 km

27941 Vogel
Autohäuser
GmbH & Co.
KG ,
Zwingenberg

Job
Job
Job
Job
Job
Job
Job
Job
Job
Job
Job

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Beratung am Fahrzeug Flat rate unit I 00 52 052	Local	1 FRU
--	-------	-------

Service Ticket Flat rate unit I 00 52 052	Local	1 FRU
--	-------	-------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Standardumfang Flat rate unit I 00 00 105	Local	2 FRU
--	-------	-------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Motoröl Flat rate unit I 00 00 610	Local	3 FRU
---	-------	-------

Set oil-filter element Part I 11 42 8 507 683	1
--	---

Motor oil SAE 5W-30 Longlife-04 Part I 83 21 0 398 509	5.2
---	-----

Windshield Washer Antifreeze Part I 83 12 2 298 206	1
--	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Mikrofilter Flat rate unit I 00 00 616	Local	3 FRU
---	-------	-------

Set, microfilter/activ. charcoal filter Part I 64 11 9 272 642	1
---	---

Pollen filter housing cleaner Part I 83 19 2 180 509	1
---	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Luftfiltereinsatz Flat rate unit I 00 00 602	Local	1 FRU
---	-------	-------

Air filter element Part I 13 71 7 800 151	1
--	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Kraftstofffilter Flat rate unit I 00 00 604	Local	5 FRU
Fuel filter cartridge Part I 13 32 7 811 227		1
Hose clamp Part I 07 12 9 952 104		1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Fahrzeug-Check Flat rate unit I 00 00 624	Local	7 FRU
--	-------	-------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Alle Scheibenwischerblätter ersetzen Flat rate unit I 61 61 547	Local	1 FRU
Set of wiper blades Part I 61 61 2 163 749		1
Wiper blade Part I 61 62 7 207 043		1

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Innenreinigung Part I W004	Local	1
-------------------------------	-------	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Bremse vorn Flat rate unit I 00 00 612	Local	7 FRU
Beide Bremsscheiben vorn aus- und einbauen/ersetzen Flat rate unit I 34 11 613	Local	3 FRU

Brake disc, lightweight, ventilated Part I 34 11 6 775 277	2
---	---

Inner hex bolt Part I 34 21 1 161 806	2
--	---

Repair kit, brake pads asbestos-free Part I 34 11 6 850 885	1
--	---

Brake pad wear sensor, front left Part I 34 35 6 791 958	1
---	---

Safety cleaner Part I 83 19 0 444 555	1
--	---

Brake pad paste Part I 83 19 2 158 851	2
---	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fahrzeug Fußraum vorne aussaugen / Wagenwäsche Flat rate unit I 00 11 317	Local	1 FRU
--	-------	-------

— Job


Description:

Is interpreted as a repeat visit: No

Customer's own words:

Ihre Rechnung wurde von Ihrem Serviceberater Flat rate unit I 44 44 444	Local	1 FRU
--	-------	-------

—	11/29/2012	Key	40413 km	Key 0
---	------------	-----	----------	-------

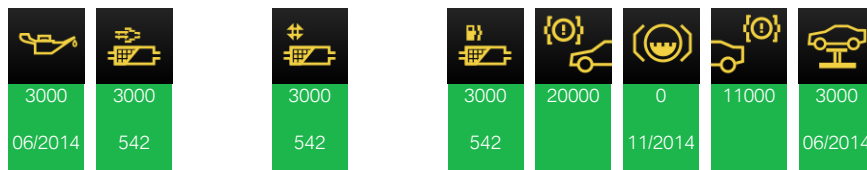

—	11/29/2012	Repair	40413 km	27941 Vogel Autohäuser GmbH & Co. KG, Zwingenberg	Job Job Job
---	------------	--------	----------	---	-------------------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

SOMMERRÄDER - Lagerung Part I 99 99 0 000 059	Local	1
--	-------	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Fahrzeug Fußraum vorne aussaugen / Wagenwäsche Flat rate unit I 00 11 317	Local	1 FRU
--	-------	-------

— Job







Description:

Is interpreted as a repeat visit: No

Customer's own words:

Ihre Rechnung wurde von Ihrem Serviceberater Flat rate unit I 44 44 444	Local	1 FRU
--	-------	-------

—	06/29/2012	Key	24101 km	Key 0
---	------------	-----	----------	-------



—	06/29/2012	Repair	24101 km	27941 Vogel Autohäuser GmbH & Co. KG , Zwingenberg	Job Job Job Job Job Job Job
---	------------	--------	----------	--	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Beratung am Fahrzeug Flat rate unit I 00 52 052	Local	1 FRU
--	-------	-------

Service Ticket Flat rate unit I 00 52 052	Local	1 FRU
--	-------	-------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Standardumfang Flat rate unit I 00 00 105	Local	2 FRU
--	-------	-------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Motoröl Flat rate unit I 00 00 610	Local	3 FRU
Set oil-filter element Part I 11 42 8 507 683		1
Motor oil SAE 5W-30 Longlife-04 Part I 83 21 0 398 509		5.2

— Job**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

Service Mikrofilter Flat rate unit I 00 00 616	Local	3 FRU
Set, microfilter/activ. charcoal filter Part I 64 11 9 272 642		1

— Job**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

Service Bremse hinten Flat rate unit I 00 00 614	Local	9 FRU
Repair kit, brake pads asbestos-free Part I 34 21 6 796 741		1
Brake pad wear sensor, rear Part I 34 35 6 791 963		1
Brake pad paste Part I 83 19 2 158 851		1
Safety cleaner Part I 83 19 0 444 555		1

— Job**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

Fahrzeug Fußraum vorne aussaugen / Wagenwäsche Flat rate unit I 00 11 317	Local	1 FRU
--	-------	-------






— Job**Description:**

Is interpreted as a repeat visit: No

Customer's own words:

Ihre Rechnung wurde von Ihrem Serviceberater Flat rate unit I 44 44 444	Local	1 FRU
--	-------	-------

—	04/19/2012	Key	17009 km	Key 1
---	------------	-----	----------	-------



—	04/19/2012	Repair	17009 km	27941 Vogel Autohäuser GmbH & Co. KG, Zwingenberg	Job Job Job
---	------------	--------	----------	---	-------------------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Service Beratung am Fahrzeug
Flat rate unit I 00 52 052

Local

1 FRU

Service Ticket
Flat rate unit I 00 52 052

Local

1 FRU

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Paket B A S I S - Räderwechsel
Flat rate unit I BASISZ

Local

6 FRU

Einlagerung Winterräder
Flat rate unit I WR04

Local

1 FRU

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

Ihre Rechnung wurde von Ihrem Serviceberater
Flat rate unit I 55 55 555

Local

1 FRU

—	01/20/2012	Repair	5387 km	26842 BMW Mobiler Service Einsatzleitzentrale , München	Job
---	------------	--------	---------	--	-----

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words:

FAHRZEUG BETANKT,KANISTER AN NÄCHSTER TANKSTELLE
DURCH KUNDEN BEFÜLLEN LASSEN
Flat rate unit I 99 99 999

Local

6 FRU

—	11/17/2011	Repair	0 km	30623 ahg Autohandelsgesellschaft mbH , Sinzheim	Job Job Job
---	------------	--------	------	--	-------------------

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words: none

Transportmodus löschen und Übergabedurchsicht mit DIS/GT1 Flat rate unit I 00 99 018	Local	0 FRU
---	-------	-------

Tele-Service freischalten Flat rate unit I 99 99 115	Local	1 FRU
---	-------	-------

Free pre-delivery check Flat rate unit I 00 00 009		9 FRU
---	--	-------

Suspension block pre-delivery check Flat rate unit I 00 00 741		1 FRU
---	--	-------

Installing navigation map(s) Flat rate unit I 65 90 600		2 FRU
--	--	-------

FRACHT RÜCKSENDUNG SOMMERRADSATZ Part I FT99990000200	Local	1
--	-------	---

Fillister head self-tapping screw Part I 07 14 3 448 498		8
---	--	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words: none

Neuwagenaufbereitung Flat rate unit I 98 99 004	Local	9 FRU
--	-------	-------

NW - Finish Part I FT9894902	Local	1
---------------------------------	-------	---

— Job

Description:

Is interpreted as a repeat visit: No

Customer's own words: none

WR montieren. SR verschicken > Adresse Dispo Flat rate unit I 36 99 007	Local	4 FRU
--	-------	-------